
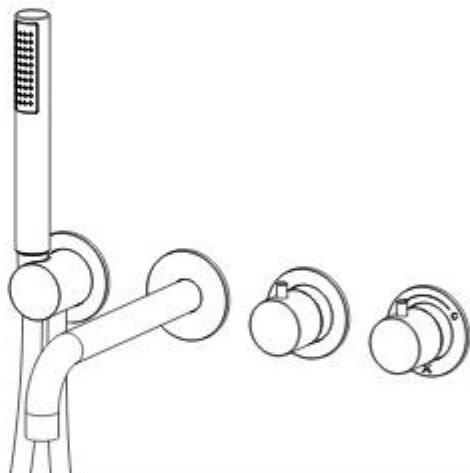
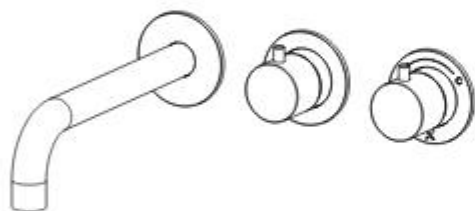
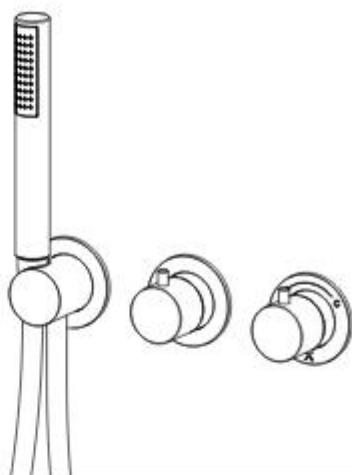


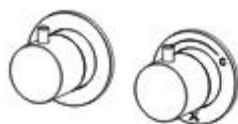

PROMODDIVLBP/PROMOD1601/PROMOD1701/PROMOD440TRIM

MOUNTING INSTRUCTIONS

PRESSURE RANGE MIN/MAX 0,5/5 BAR
(IN CASE OF WATER PRESSURE HIGHTER THAN 5 BAR WE RACOMMEND
INSTALLING PRESSURE REDUCERS).
RECOMMENDED PRESSURE 3 BAR.

OPERATION:
EITHER WITH GAS OR ELECTRIC ACCUMULATION BOILERS.
CENTRALISED SYSTEMS.


The product should only be installed by a suitably qualified plumber/
installer.

SAFETY LOCK AT:	41° C
MIN. WORKING TEMPERATURE:	3° C
MIN. RECOMMENDED:	15° C
MAX. WORKING TEMPERATURE:	70° C
MAX. RECOMMENDED:	65° C
RECOMMENDED THERMAL DIFFERENTIAL	50° C
THERMAL DISINFECTION IS ALLOWED.	

SAFETY SYSTEM WITH FLOW STOP IN CASE OF LACK OF ONE OF THE TWO
WATERS.

WARNING: CONTACT THE PLUMBER FOR THE CHOICE OF THE BEST WATER
HEATING DEVICE.

MODULE 2 CONTROL DIVERTER 2-WAY

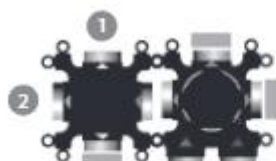


press.	flow-rate L/min.		
bar	Exit 1	Exit 2	Exit 1+2
0,5	9,2	9,2	9,7
1	13	13	13,7
2	18,7	18,7	19,7
3	23	23	24,2
4	26,5	26,5	28
5	29,5	29,5	31,4

MODULE 2 CONTROL DIVERTER 3-WAY



press.	flow-rate L/min.		
bar	Exit 2	Exit 1	Exit 3
0,5	10	10	9,7
1	13,6	13,7	13,4
2	19,2	19,5	19
3	23,4	23,8	23,3
4	27	27,5	26,8
5	30	30,5	29,8

MODULE 2 CONTROL 2-WAY TRIMSET WITH HANDSHOWER

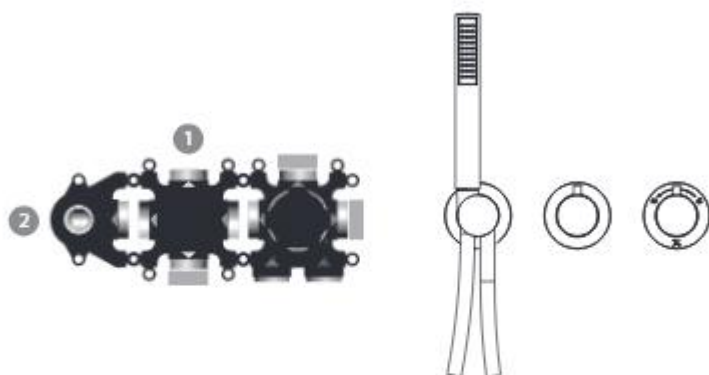


press.	flow-rate L/min.		
bar	Exit 1	Exit 2 for Shower	Exit 1+2
0,5	9,2	4,2	9,3
1	13	6	13,4
2	18,7	8,5	19
3	23	10,7	23,5
4	26,5	12,3	27
5	29,5	13,8	30,3

MODULE 2 CONTROL 2-WAY TRIMSET WITH BATH SPOUT



press.	flow-rate L/min.		
bar	Exit 1	Exit 2 for Spout	Exit 1+2
0,5	9,2	8,5	10
1	13	12,5	14,1
2	18,7	18	20
3	23	22,3	24,6
4	26,5	26	28,6
5	29,5	29	32

MODULE 2 CONTROL 3-WAY TRIMSET WITH HANDSHOWER

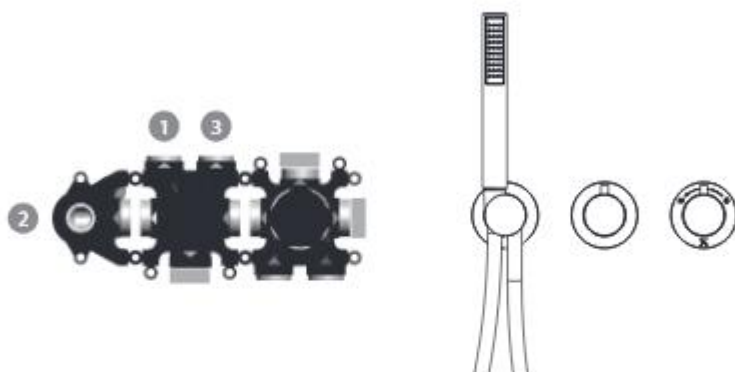


press.	flow-rate L/min.		
bar	Exit 2 Hand Shower	Exit 1	Exit 3
0,5	4,1	10	9,7
1	6	13,7	13,4
2	8,5	19,5	19
3	10,6	23,8	23,3
4	12,3	27,5	26,8
5	13,8	30,5	29,8

MODULE 2 CONTROL 3-WAY TRIMSET WITH BATH SPOUT




press.	flow-rate L/min.		
bar	Exit 2 Bath Spout	Exit 1	Exit 3
0,5	8,5	10	9,7
1	12,5	13,7	13,4
2	18	19,5	19
3	22,3	23,8	23,3
4	26	27,5	26,8
5	28,8	30,5	29,8

MODULE 2 CONTROL 2-WAY TRIMSET WITH
BATH SPOUT & HANDSHOWER

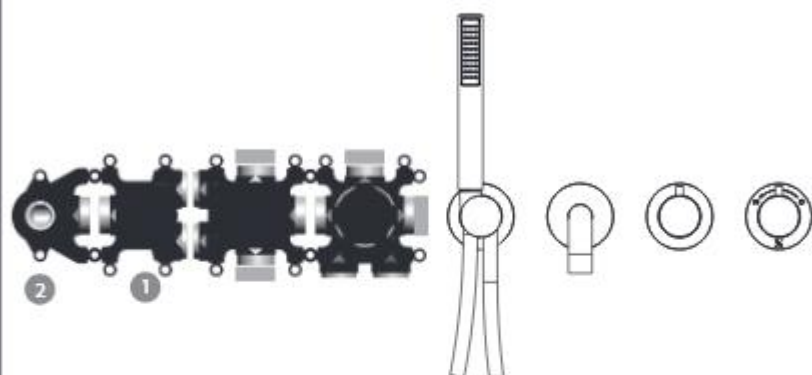

press.	flow-rate L/min.		
bar	Exit 1 Bath Spout	Exit 2 Hand shower	Exit 1 +2
0,5	8	4,1	8,8
1	11,7	6	12,7
2	17	8,5	18,3
3	21	10,6	22,5
4	24	12,3	25,6
5	26,7	13,8	28,5


MODULE 2 CONTROL DIVERTER TRIMSET

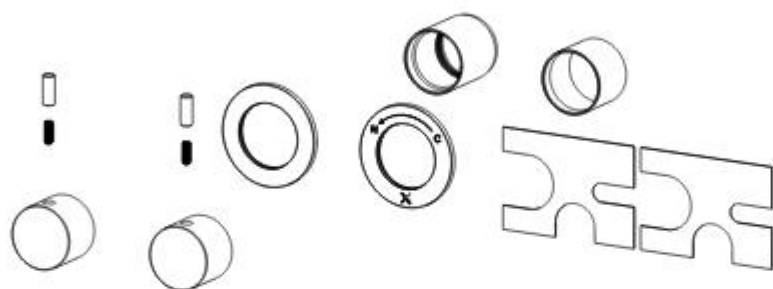


GB MOUNTING ISTRUCTIONS




MODULE 2 CONTROL TRIMSET WITH HANDSHOWER

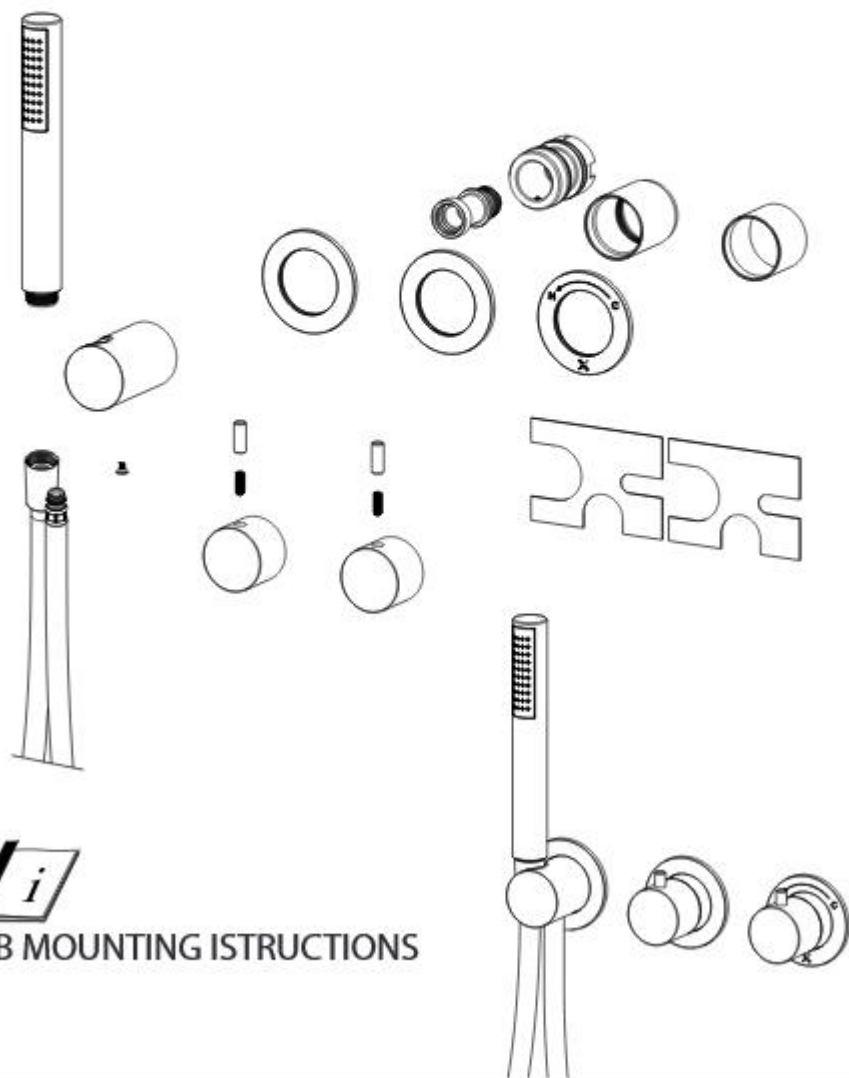


MODULE 2 CONTROL TRIMSET WITH BATH SPOUT




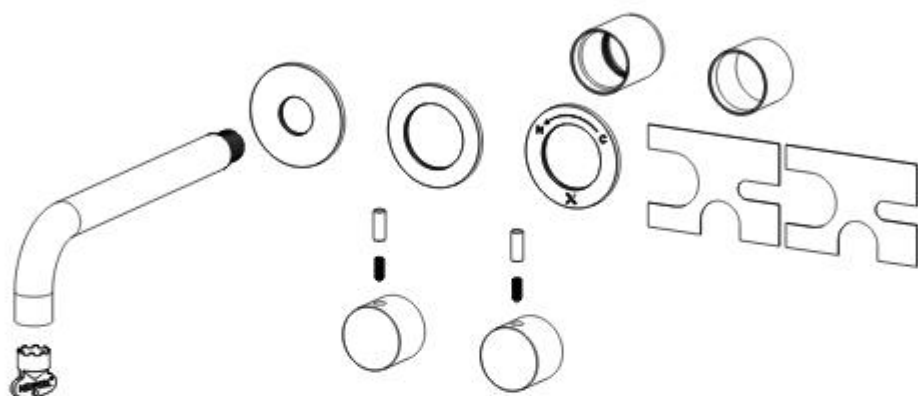




GB MOUNTING ISTRUCTIONS


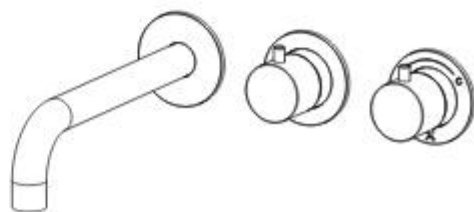


MODULE 2 CONTROL TRIMSET WITH BATH SPOUT & HANDSHOWER

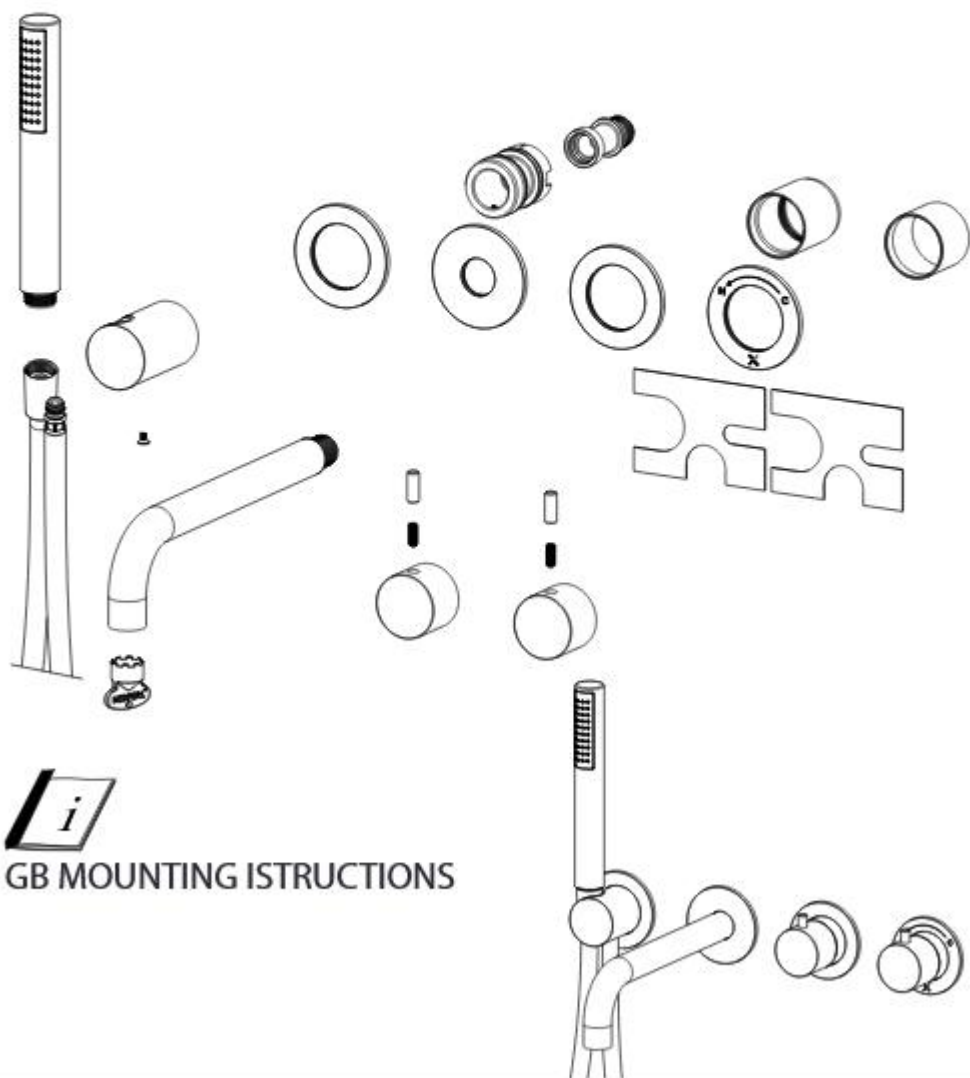


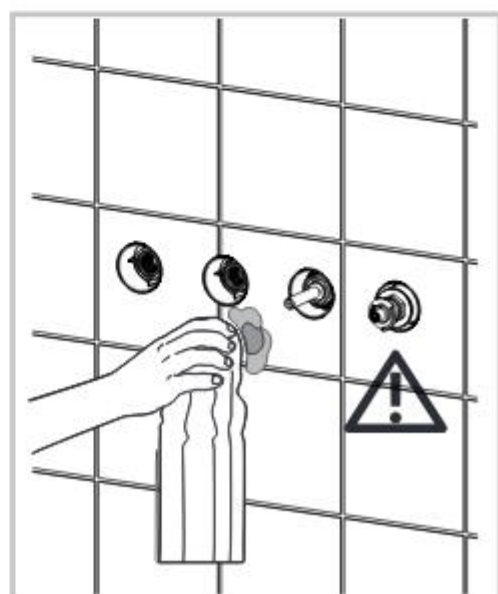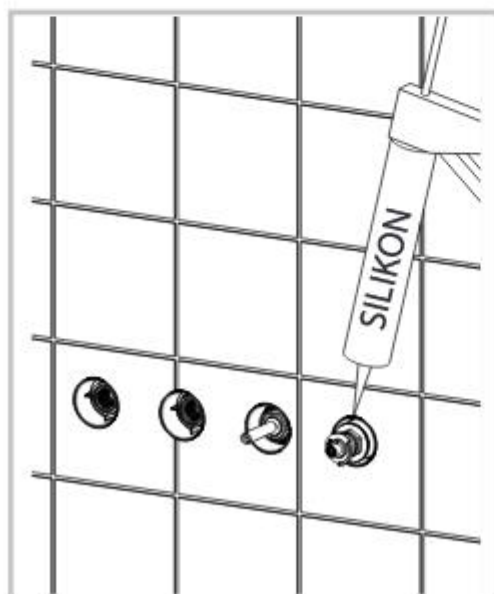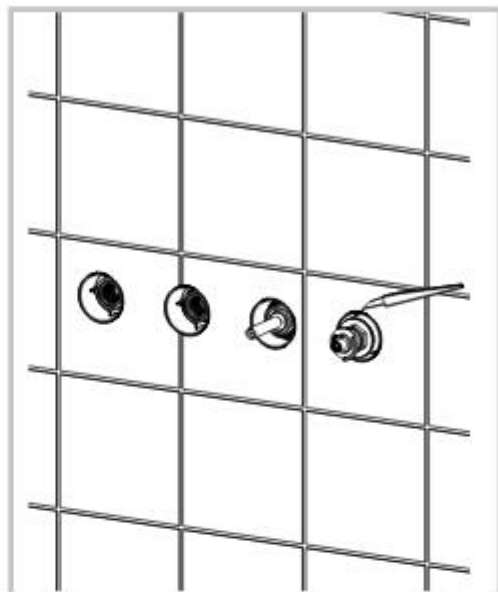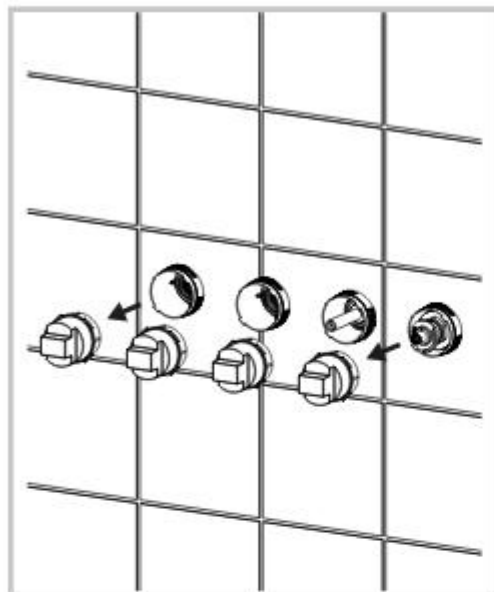

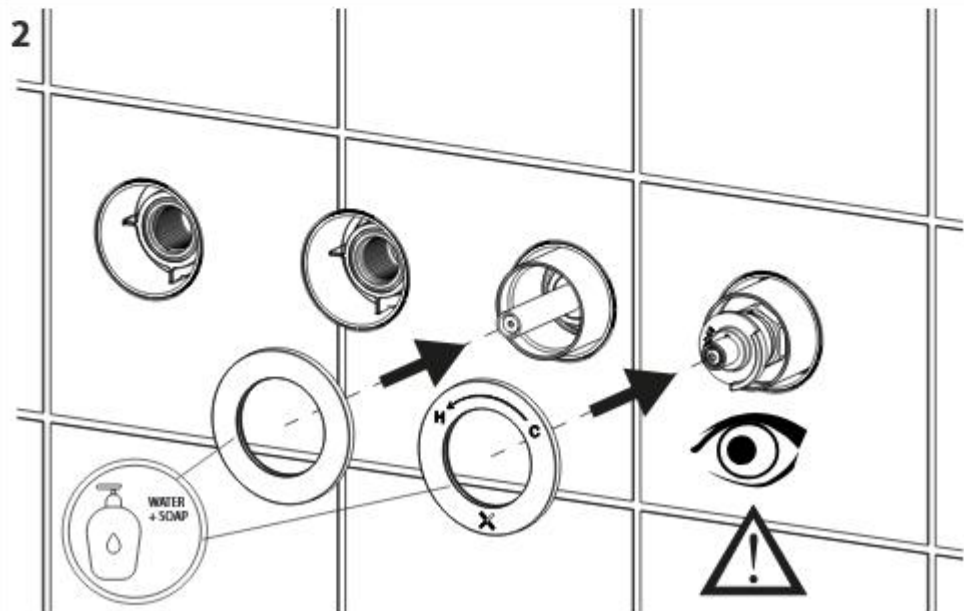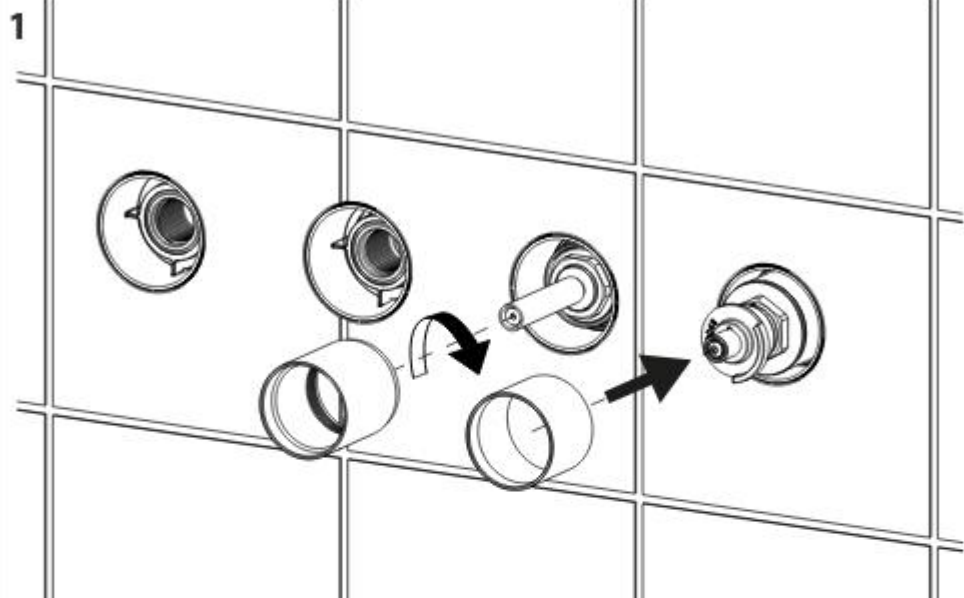


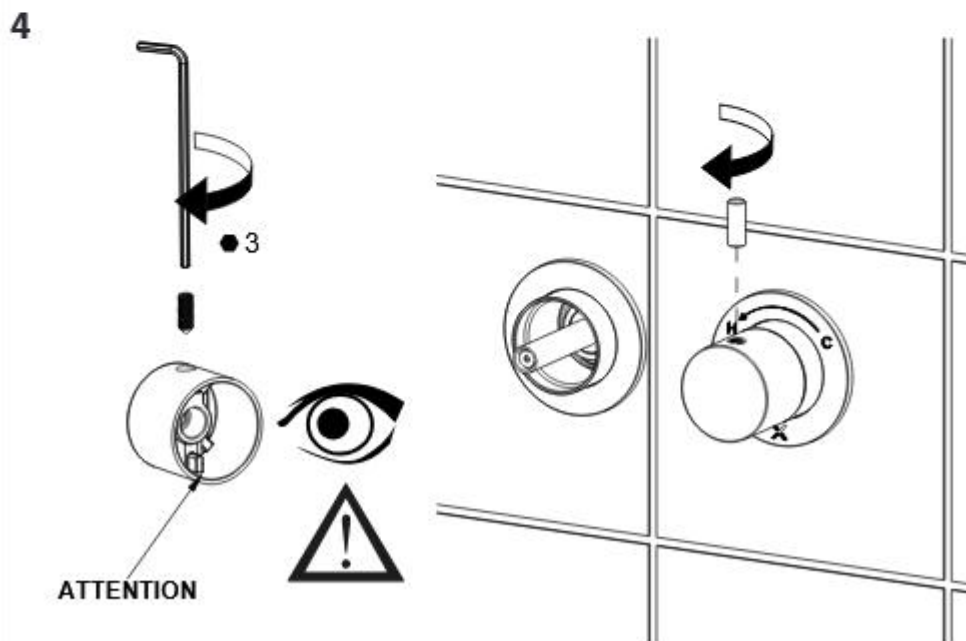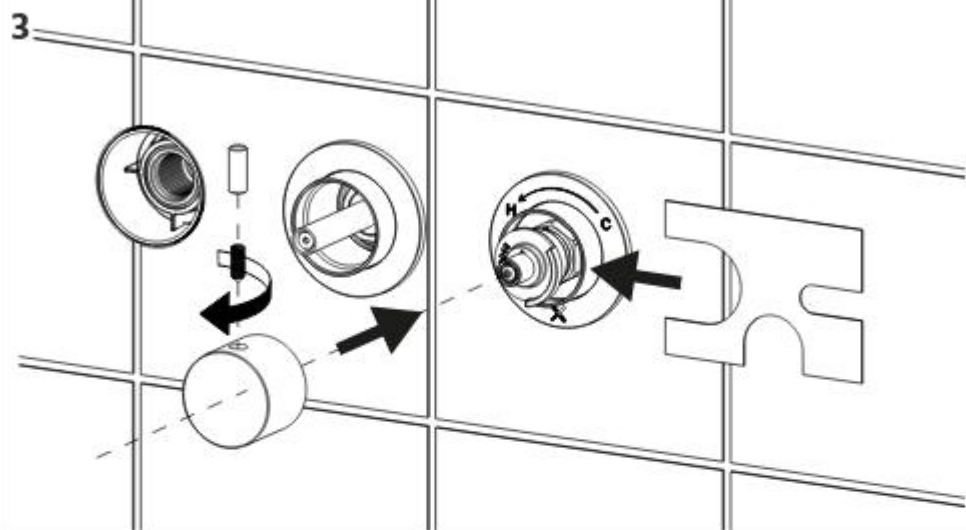


5

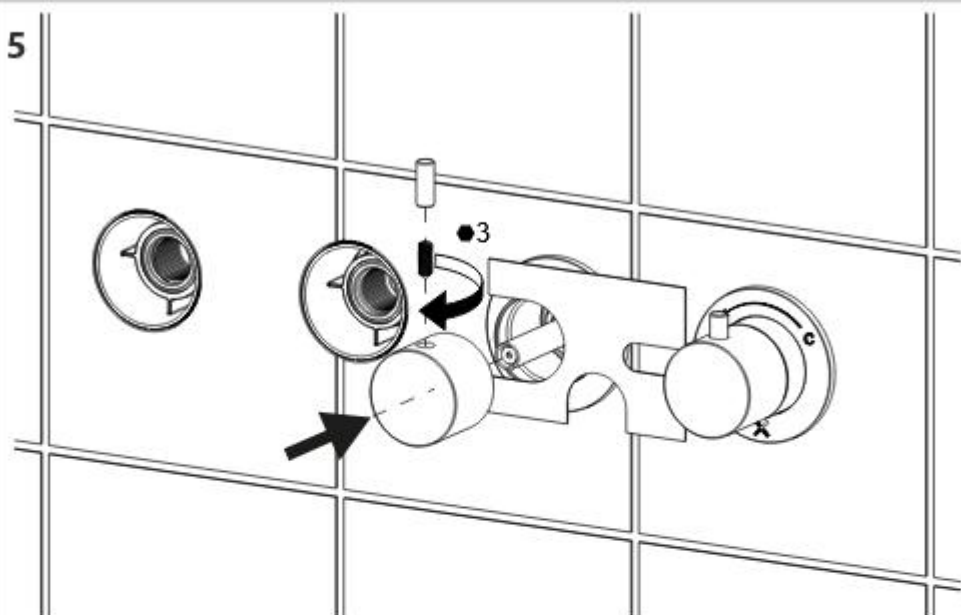


6

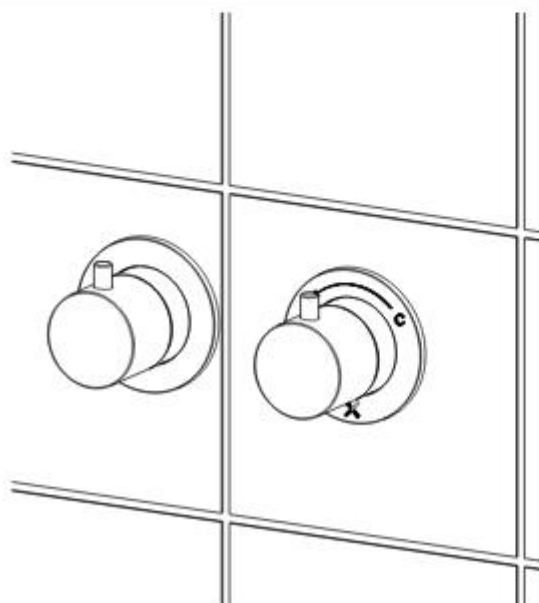**OK**


- 7** ATTENTION: CHECK THE CLEANING OF THE INDICATED AREAS BEFORE PROCEEDING WITH THE INSTALLATION OF THE AESTHETIC PARTS, DRAIN A GOOD QUANTITY OF WATER TO CLEAN THE SYSTEM FROM DIRT AND RESIDUES.

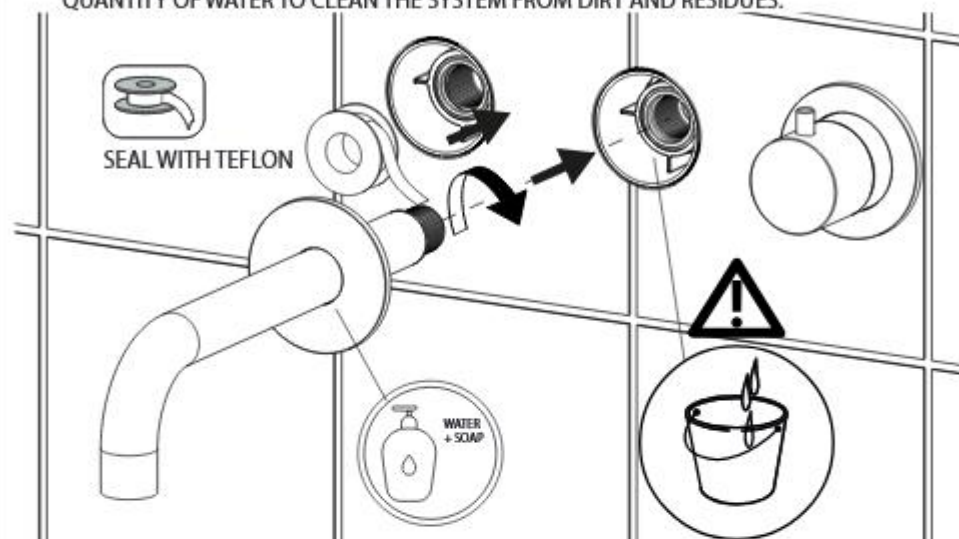


- 8**
-
- Diagram 8 shows the final orientation and locking of the spout. A warning triangle with an exclamation mark is placed over the spout, with the text "ORIENT AND LOCK THE SPOUT" below it. The word "OK" is displayed to the right. Below the main diagram, three small circular icons show different views of the spout, with the word "OK" repeated next to them.

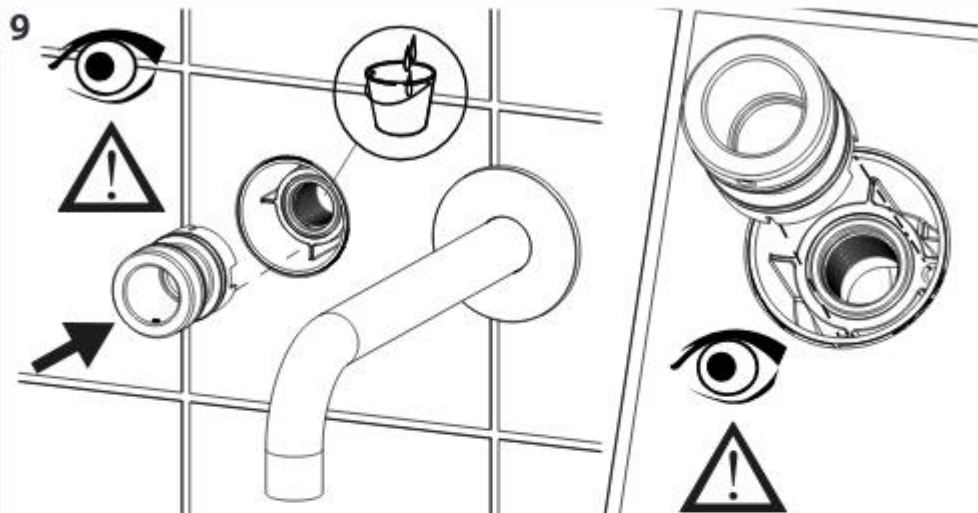


ATTENTION: CHECK THE CLEANING OF THE INDICATED AREAS BEFORE PROCEEDING WITH THE INSTALLATION OF THE AESTHETIC PARTS, DRAIN A GOOD QUANTITY OF WATER TO CLEAN THE SYSTEM FROM DIRT AND RESIDUES.

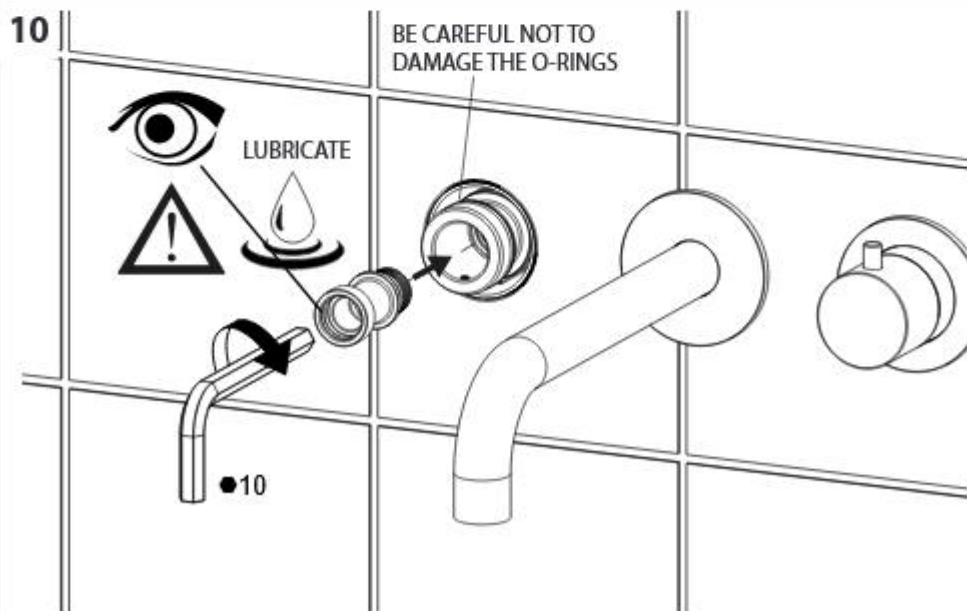


11

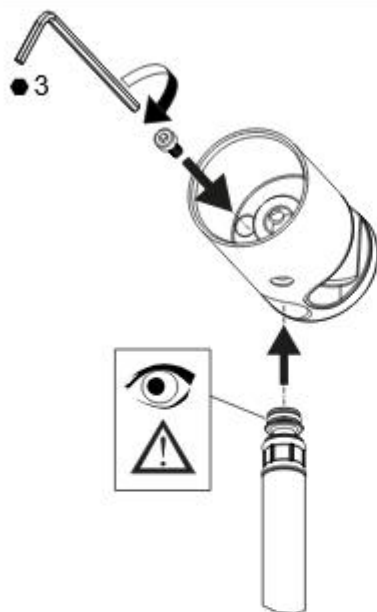


ATTENTION:
CHECK THE CORRECT POSITION OF THE HOSE

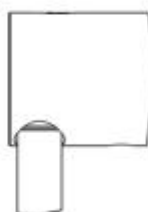**OK****NOT OK**


12


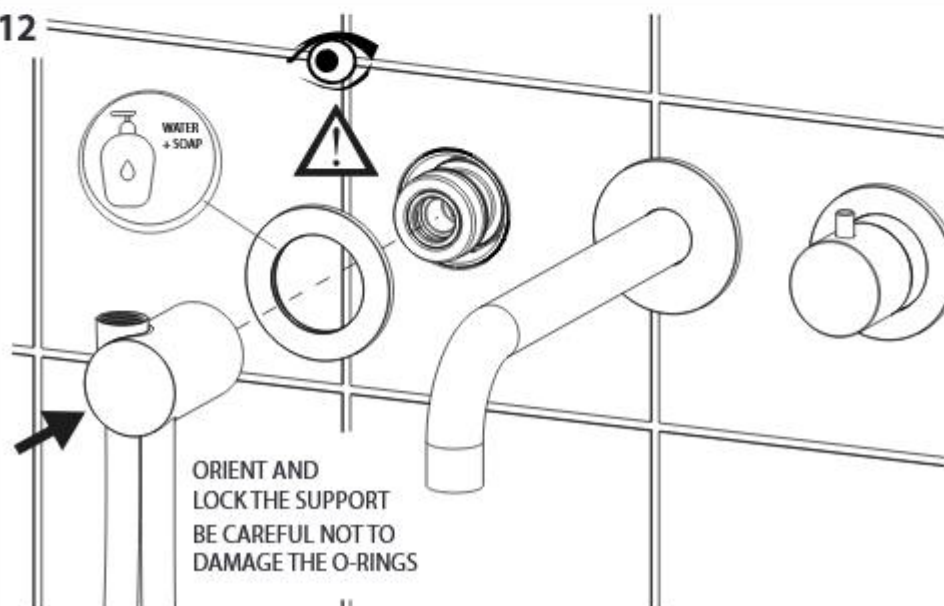




13

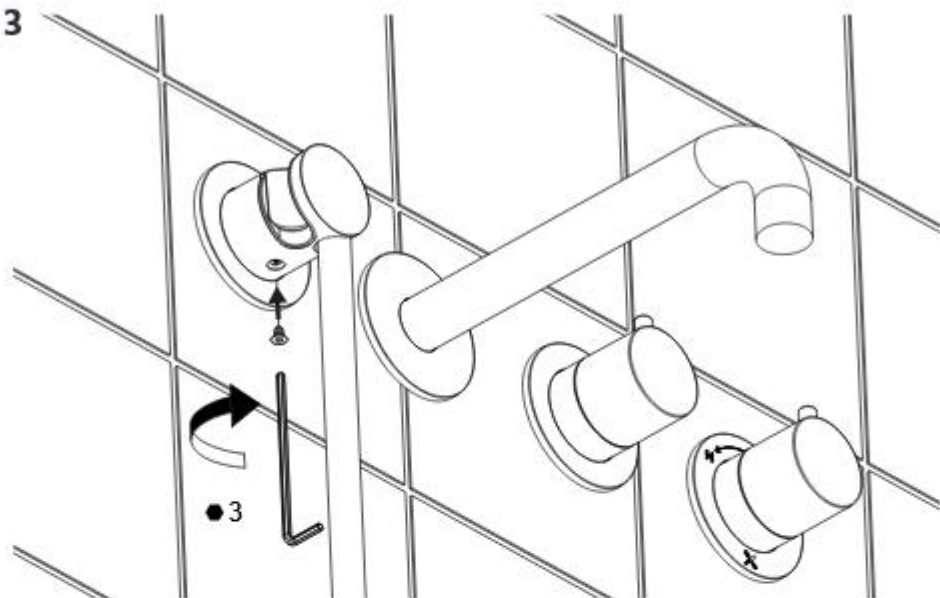



14

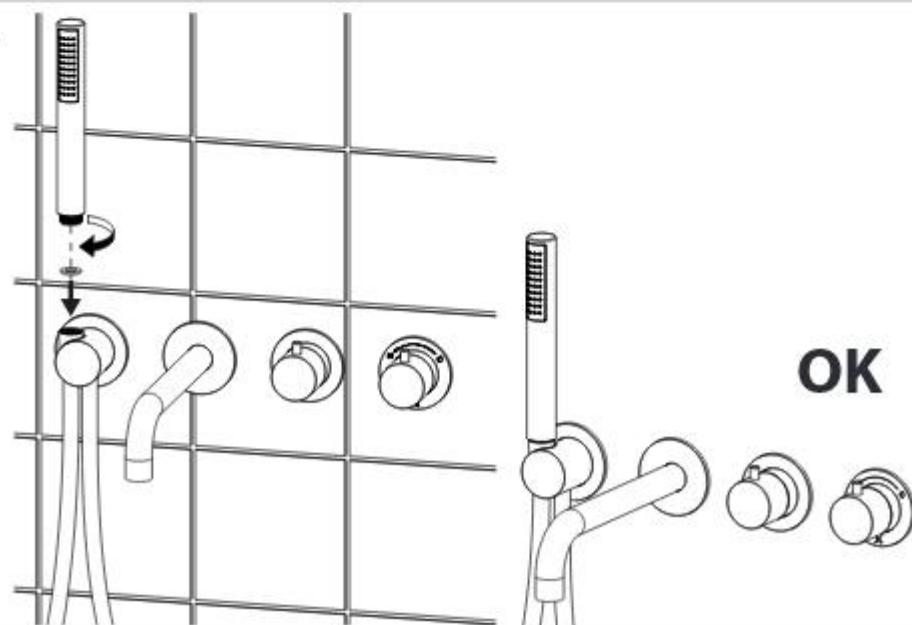


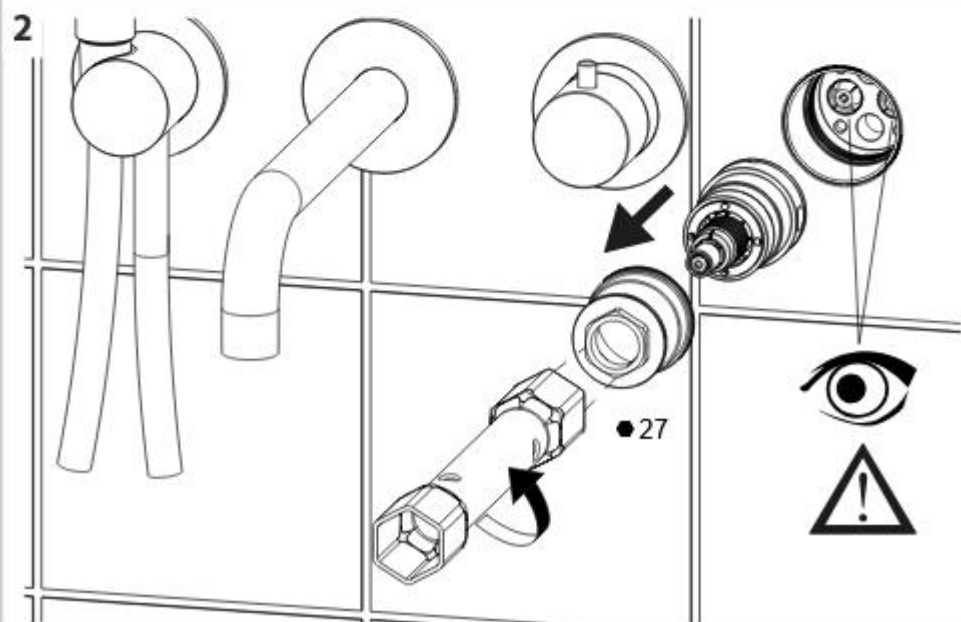
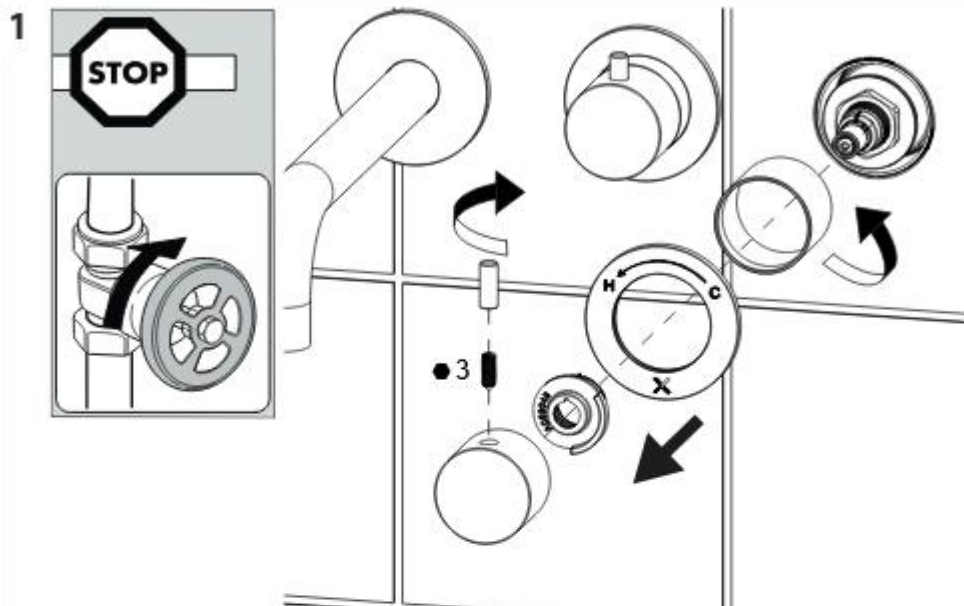


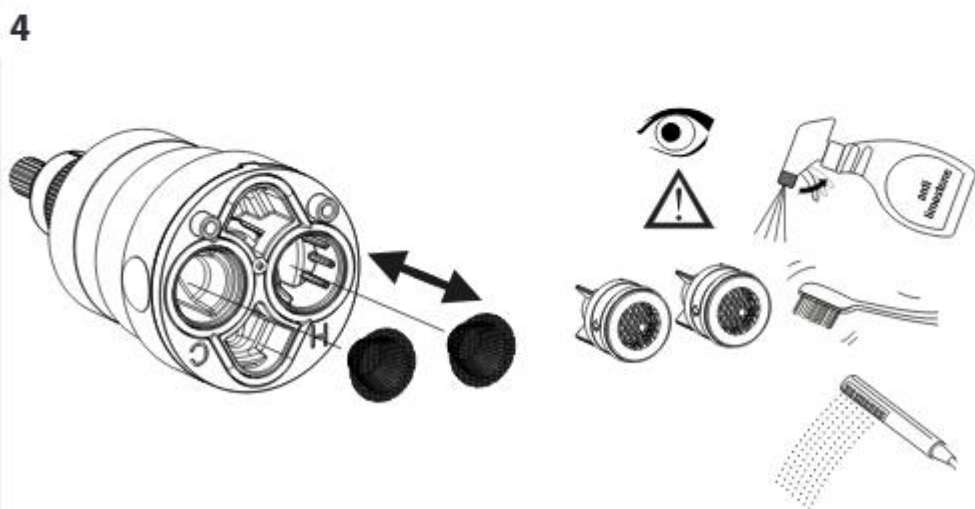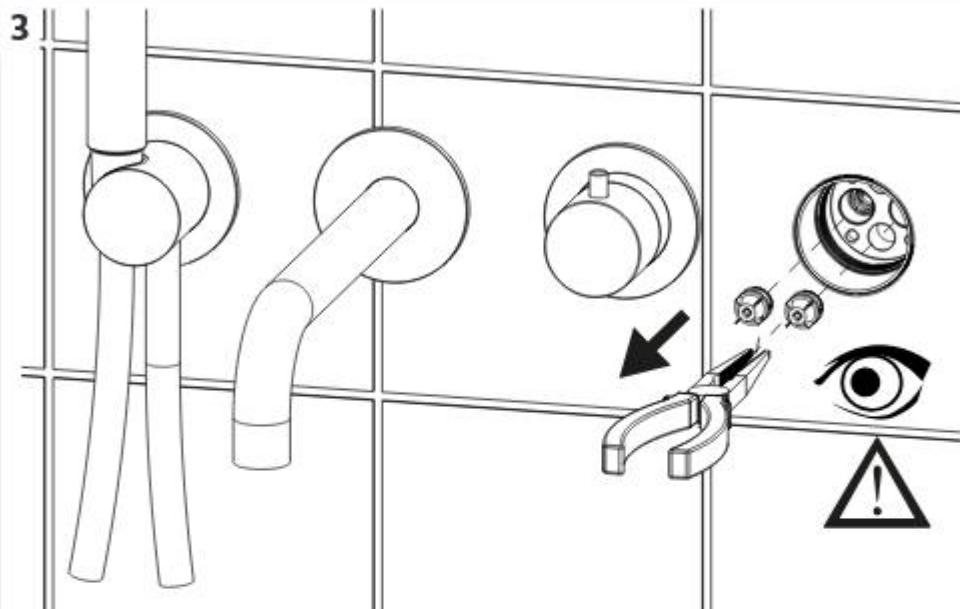



5

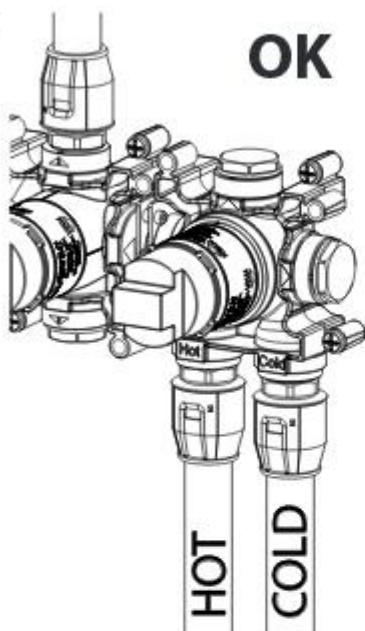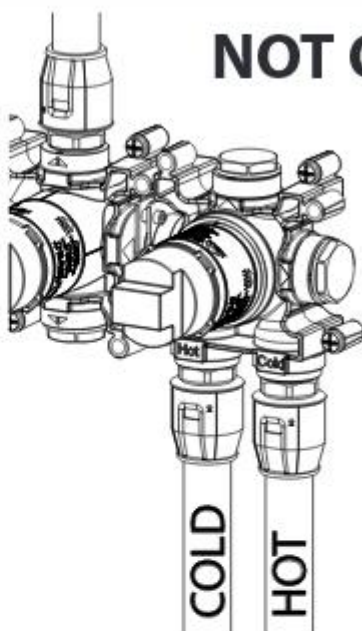OK**NOT OK**


6

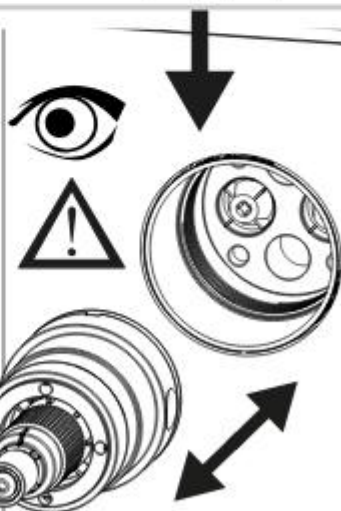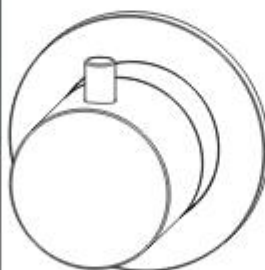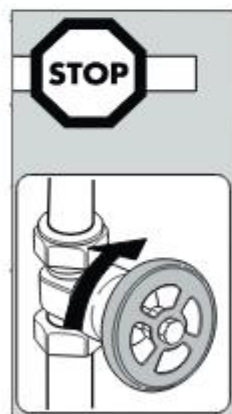**ROTATE 180°**


7

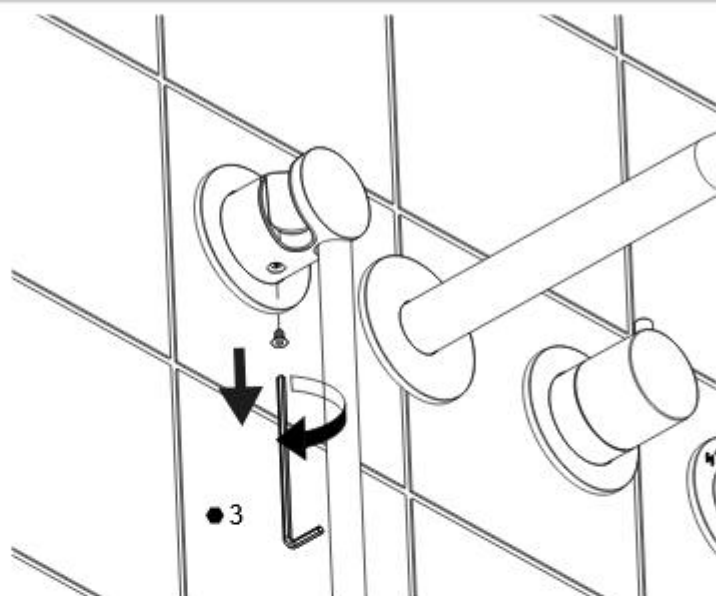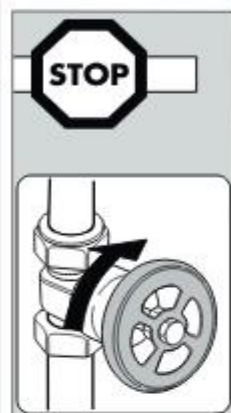

8

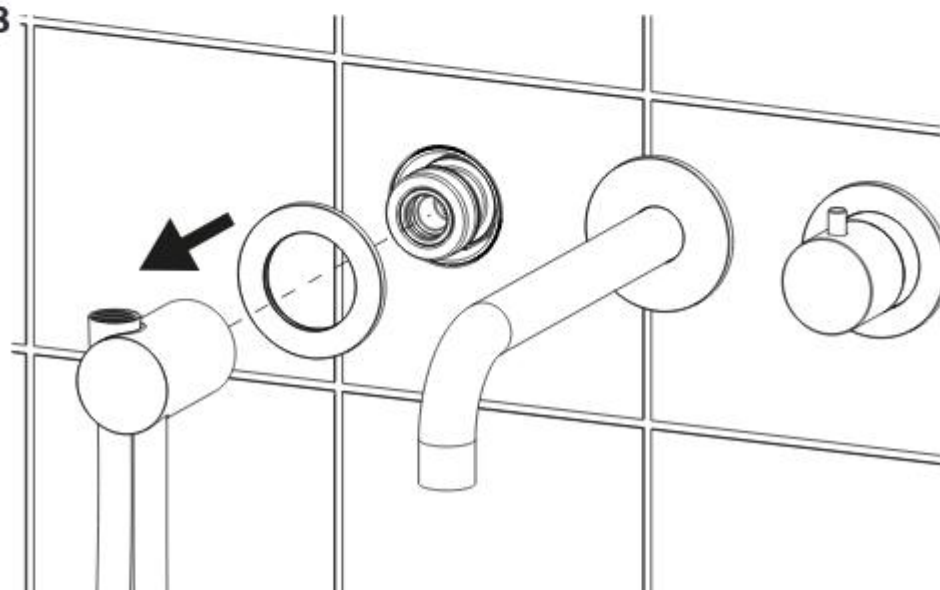

9

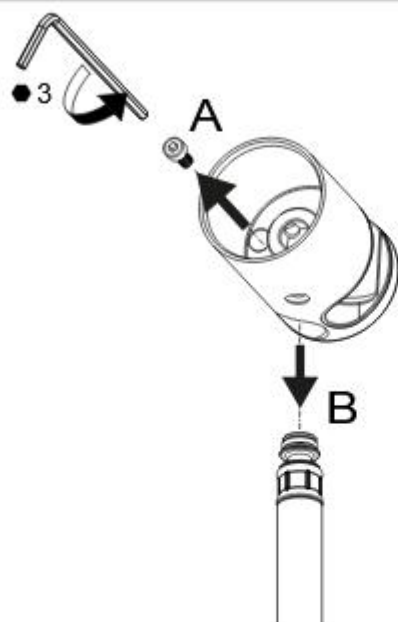

**REPLACE THE FLEX HOSE
AND START FROM POINT 11**

